# 3800-FM-BCW0271g Rev. 11/2022 Chapter 102 Inspection Report pennsylvania DEPARTMENT OF ENVIRONMENTAL PROTECTION

## COMMONWEALTH OF PENNSYLVANIA DEPARTMENT OF ENVIRONMENTAL PROTECTION BUREAU OF CLEAN WATER

Save as PDF

Clear Report

### **CHAPTER 102 INSPECTION REPORT**

**PA Department of Environmental Protection** 

Permit No.:	PAD510225

Report No.: 16

GENERAL INFORMATION					
Project/Site Name:	Alliance 51st Street, Philadelphia	Permit Issuance Date:	9/5/2023		
Site Address:	1656 S. 51 <sup>st</sup> St.	Permit Expiration Date:	-		
Site City, State, ZIP:	Philadelphia, PA 19143	Permit Type:	NPDES IP		
RP/Permittee Name:	Eric Carlson	Site Municipality(ies):	Philadelphia		
RP/Permittee Address:	40 Morris Ave., Suite 230	Site County(ies):	Philadelphia		
RP/Permittee City, State, Z		Earth Disturbance:	11.54	acres	
RP/Permittee Email:	ecarlson@alliancehp.com	Site Latitude:	39.935278		
Surface Water(s):	Schuylkill River	Site Longitude:	75.209236		
Special Protection?	☐ Yes ⊠ No	Complaint Inspection?		☐ No	
Construction Stage:	Inactive	Activity:	Construction	ı <u>&gt;</u> 1 ac.	
Operator Name	Operator Company	Operator E	mail	Approved	
n/a					
INSPECTION INFORMATION					
Inspection Date:	1/8/25	Inspection Time:	11:45	АМ 🗌 РМ	
Lead Inspector Name:	Robert Page	Inspector Email:	ropage@pa.ge	οv	
Inspector Title:	Env. Grp. Mgr.	Inspector Phone:	484.250.5104		
Other Inspector(s):	n/a	Weather:	Sun and cloud	ls, 30°F	
Was a representative of the project on-site during the inspection?					
Representative Name:	n/a	Email: n/a			
Representative Company:	n/a	Phone: n/a			
Type of Inspection:	Initial 🛛 Follow-up (Previous Re	eport #15)	] Photographs	attached	
Brief description of the site	and summary of observations:				
Robert Page (DEP) conducted a Chapter 102 inspection of this industrial redevelopment site (reference previous Chapter 102 inspections between July 18 and December 10, 2024).					
No permittee representatives were present; I did not enter the site and took all pictures and observations from 51st Street and the Bartram's Garden trail. Two vehicles and a towable drilling rig (Hawk Drilling) were onsite with 2 to 3 drilling contractors on site.					
I noted that the filter sock along both 51 <sup>st</sup> St. gates to the site were in proper position and in good operating condition. Most of the ground was covered with a thin layer of snow and ice during this inspection. The stone stockpile appeared similar in appearance as with recent past inspections.					
The erosion gullies first noted on the large fill dirt stockpile (first described in Report No. 10, 10/22/24), remained present. Failure of temporary stabilization to minimize accelerated erosion and sedimentation is a violation of 25 Pa. Code, Section 102.22(b).					
		(summ	ary continued c	n Page 4)	

3800-FM-BCW0271g Rev. 11/2022 Chapter 102 Inspection Report

		INSPECTION FINDINGS
		No violations observed at this time.
a.		Failure to implement and/or maintain E&S BMPs for earth disturbance (§§ 102.4(b)(1), 102.22(a)(1)).
b.		Failure to develop and/or implement a written E&S Plan (§ 102.4(b)(2)).
C.		Failure to have a person trained and experienced in E&S control methods develop an E&S Plan (§ 102.4(b)(3)).
d.		Failure to have the E&S Plan and/or inspection/monitoring reports on-site and available for review (§ 102.4(b)(8)).
e.		Failure of permittee to obtain all necessary approvals/permits from DEP/CCD prior to commencing earth disturbance (§ 102.4(d)).
f.		Failure to hold a pre-construction meeting and/or invite DEP/CCD staff and/or provide at least 7 days' notice (§ 102.5(e)).
g.		Failure of an operator to submit a co-permittee acknowledgement form (§ 102.5(h)).
h.		Failure to prepare and/or implement and/or provide upon request a PPC Plan when required (§ 102.5(I)).
i.	$\boxtimes$	Failure to temporarily stabilize areas where there will be a cessation of earth disturbance activities for at least 4 days (§ 102.22(b)).
j.		Failure to complete or accurately complete visual site inspections as required by the permit (CSL § 402(b)).
k.		Failure to implement PCSM BMPs as specified in the approved PCSM Plan (§ 102.8(a)).
I.		Failure to operate and maintain PCSM BMPs as specified in an approved PCSM Plan or deed (§ 102.8(a)).
m.		Failure to have the PCSM Plan, inspection reports, and/or monitoring records available for review (§ 102.8(j)).
n.		Failure to have a licensed professional or a designee present on-site during critical stages of PCSM BMPs (§ 102.8(k)).
0.		Failure to record an instrument for PCSM BMPs (§ 102.8(m)(2)).
p.		Failure to meet riparian forest buffer criteria (§ 102.14(b)).
q.		Failure to permanently stabilize a project site or any phase or stage thereof (§ 102.22(a)).
r.		Failure to remove temporary E&S BMPs once permanent stabilization has been established (§ 102.22(a)(1)).
S.		Failure to obtain NPDES permit prior to commencing earth disturbance activity with at least one acre of disturbance (§ 102.5(a)).
t.		Failure to obtain E&S permit prior to commencing earth disturbance activity with at least 25 acres of disturbance for timber harvesting and road maintenance (§ 102.5(b)).
u.		Failure to obtain E&S permit prior to commencing earth disturbance activity with at least 5 acres of disturbance for oil and gas activities (§ 102.5(c)).
٧.		Failure of activity not requiring a permit to comply with Chapter 102 requirements (§ 102.5(k)).
W.		Failure to follow the approved construction sequence in an E&S or PCSM Plan (CSL § 402(b)).
X.		Failure to submit a Notice of Termination (NOT) (§ 102.7(a)).
y.		Unauthorized discharge of polluting substances to waters of the Commonwealth resulting in pollution (CSL § 401).

Permit No.: PAD510225
Report No.: 16

3800-FM-BCW0271g Rev. 11/2022 Permit No.: PAD510225 **Chapter 102 Inspection Report** Report No.: 16 Failure to comply with the terms and conditions of a permit or order (CSL § 402(b)). Z. Failure to remove building materials and/or wastes from the site for recycling or disposal in accordance aa. with DEP regulations as required by the permit (CSL § 402(b)). bb. Failure to comply with DEP regulations or the Clean Streams Law (CSL § 611). Failure to take necessary measures to prevent pollutants from reaching waters of the Commonwealth (§ CC. 91.34(a)). Failure to notify DEP of new or expanded earth disturbance not identified in an NPDES permit application dd. (§ 92a.24(b)). Failure to notify and/or obtain authorization from DEP/CCD for changes to NPDES permitted activities (§ ee. 92a.41(a)(12)). ff. Other: During the inspection violations of Chapter 105 were observed and are identified in a separate Chapter 105 inspection report. E&S BMPs were evaluated and appear to be functioning as designed. П PCSM BMPs were evaluated and appear to be functioning as designed. Form 3800-FM-BCW0531a was used to document the PCSM BMP evaluation. There is a need for modifications to the E&S Plan, PCSM Plan, or permit coverage. Describe: **COMPLIANCE ASSISTANCE RECOMMENDATIONS** 1. Significant erosion gullies remain on the large fill dirt stockpile. To maintain compliance with 25 Pa. Code, Section 102.22(b), addressing and maintaining the temporary stabilization of the large fill dirt stockpile is recommended. 2. In accordance with DEP's Erosion and Sediment Pollution Control Program Manual, Technical Guidance No. 363-2134-008 (March 2012), Page 65, inspect filter socks weekly and after each runoff event. In addition, DEP requests that damaged socks be repaired according to manufacturer's specifications or replaced within 24 hours of inspection. 3. Replacing the black tarp over the small contaminated dirt stockpile and further securing it from blowing off from high winds is recommended.

## 3800-FM-BCW0271g Rev. 11/2022 Permit No.: PAD510225 **Chapter 102 Inspection Report** Report No.: 16 ADDITIONAL COMMENTS (continued from Page 1) The black tarp covering the small pile of contaminated soil downslope of the large fill dirt stockpile was partially blowing off the stockpile. Perimeter control (filter sock) around this pile, and the downslope site perimeter, remained intact. Sediment staining on the section of the Bartram's Garden trail that was visible (not covered by ice and snow) appeared similar overall as in previous inspections. One inlet protection filter sock was in place along the wall of the Bartram's Garden trail. The previously damaged section of perimeter security fence was repaired. DEP will be continuing to follow up on this site, and Robert Page can be reached at 484.250.5104 or ropage@pa.gov. **NOTICE AND SIGNATURES** This report is official notification that a representative of the Department of Environmental Protection (DEP) has conducted an inspection of your earth disturbance activity to determine compliance with 25 Pa. Code Chapter 102 and the Pennsylvania Clean Streams Law. This representative may be an employee of a County Conservation District (CCD), which by delegation agreement with DEP is authorized to investigate complaints, inspect earth disturbance activities and conduct compliance actions. Any violations observed by DEP/CCD have been noted in this report and constitute unlawful conduct as defined in Section 611 of the Clean Streams Law. Failure to take corrective actions to resolve the violations may result in administrative, civil and/or criminal penalties being assessed by DEP as as specified at Section 602 of the Clean Streams Law. The Clean Streams Law provides for up to \$10,000 per day in civil penalties, up to \$10,000 in summary criminal penalties, and up to \$25,000 in misdemeanor criminal penalties for each violation. This report does not constitute an Order or appealable action of DEP. Nothing contained herein shall be deemed to grant or imply immunity from legal action for any violation noted herein. For further information or assistance contact the DEP/CCD inspector. The Project Site Representative's signature acknowledges that they have read the report and were given an opportunity to discuss the report with the inspector. The signature does not necessarily mean the signee agrees with the report. All comments by the inspector are based on visual site observations and do not constitute professional practice under applicable law.


Violations are documented in this report and this report serves as a Notice of Violation (NOV).
 A follow-up inspection will occur on or about: ongoing
 1/13/2024

Site Representative Signature Date Inspector Signature Date

cc: Philadelphia Water Department

### **PHOTOGRAPHS**

Permit No.: PAD510225
Report No.: 16- 1/8/24

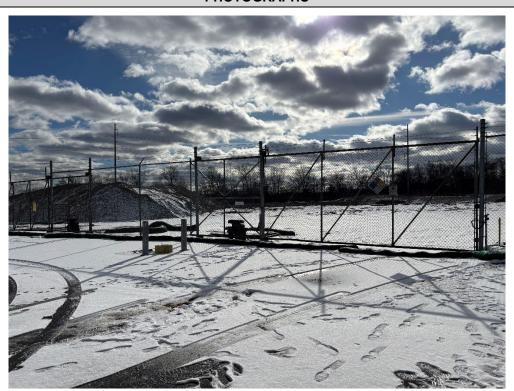

Most upslope gate and filter sock, along 51st St.



Stone stockpile on 51st St. side of site.

# PHOTOGRAPHS

Looking downslope along fence and filtersock from 51st St.



Midslope portion of site with drilling contractors and stockpiles in view.

### **PHOTOGRAPHS**



Large fill dirt stockpile with erosion gullies visible.



Contaminated fill dirt stockpile in front of larger fill dirt stockpile.

# PHOTOGRAPHS

Bartram's Garden trail just downslope of site.



Bartram's Garden trail with one inlet protected with filtersock.



Drilling contractors present on site. End of photo log.