



NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road
Primary Facility ID: 881609 _____



Inspection Date: 9-17-25		Inspection Time: 9:15		Lat/Long:	
Program: ECB		☐ Storage Tanks		☐ HSCA	
				☒ LRP	
Owner Name: Energy Transfer			Inspection ID:		Site ID:
Facility Location (911) Address: Glenwood Drive and Walker Road Washington Crossing, PA 18977				Municipality: Upper Makefield Twp.	
				County: Bucks	
Responsible Official Name: Brad Fish				Responsible Official Address:	
Title: Senior Environmental Specialist Emergency Response & Remediation				100 Green Street Marcus Hook, PA 19061	
Responsible Official Telephone: 610-859-6297					
Email Address: bradford.fish@energytransfer.com					
Entities Present: DEP – Rebecca Flannery ET – Chris Embry, Eljia Contreas RETTEW – David Anderson Bucks County Health Department Stantec - Air and Sound Monitoring Raab Drilling – Potable well installation Anson – Traffic control					
Purpose: Oversight of potable well installation at [REDACTED]					
Weather: Mostly sunny					
Narrative:					
- I arrived at the site at 9:15am and was told that the casing was installed the previous day to 81 feet bgs. and bentonite installed at the bottom of the well hole. - Chris informed me that the goals for the day were to grout the well and then use a 6" drill bit to a depth of 150 feet bgs. After the target depth is achieved, geophysics were going to be performed to determine how far to set the casing. - I questioned if drilling could be performed without letting the grout set, I was informed by Chris and the driller that as long as there is bentonite beneath the grout, it is allowed. - The employee from the Bucks County Health Department was at the site to ensure that the well was grouted to the top. - There were three different diameter temporary casing in the well hole, 17 1/2", 12", and a 6". The grout was pumped in between the 17 1/2" and 15" casings. - Drilling started using the 6-inch drill bit at 81 feet bgs. - After drilling started, bubbles were noticed coming up from the recently installed grout and was stopped. - Grout was observed entering the 6" casing, which implied that either the grout was not the correct thickness and/or the bentonite layer did not properly seal. - The decision was made to pull the 6" casing and let the grout set then drill the next day. - ET did apply oil dry to spots in the road where the drilling vehicles leaked fluid. Absorbent pads were also placed under the vehicles to capture any additional fluid that might leak.					
I did speak with the resident at [REDACTED] to explain what the activities the drillers had completed so far.					
I departed the site at: 14:12					

DEP Representative Name Rebecca Flannery		DEP Representative Signature Rebecca Flannery Digitally signed by Rebecca Flannery Date: 2023.09.21 13:28:27 -0400		Title Geoscientist	
				Date: 9-23-25	
				Telephone: 484-250-5779	
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>					
Interviewee Name		Interviewee Signature		Title	
				Date:	
				Telephone:	

NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road
Primary Facility ID: 881609

MAPS / PHOTOGRAPHS / ATTACHMENTS

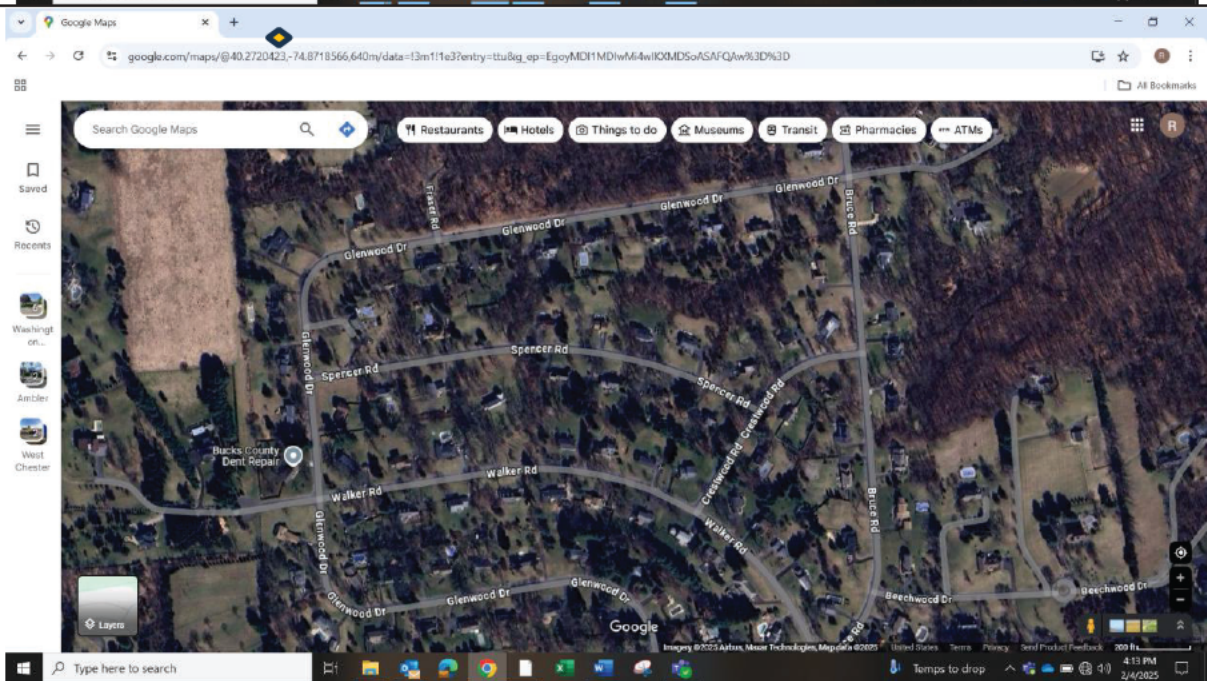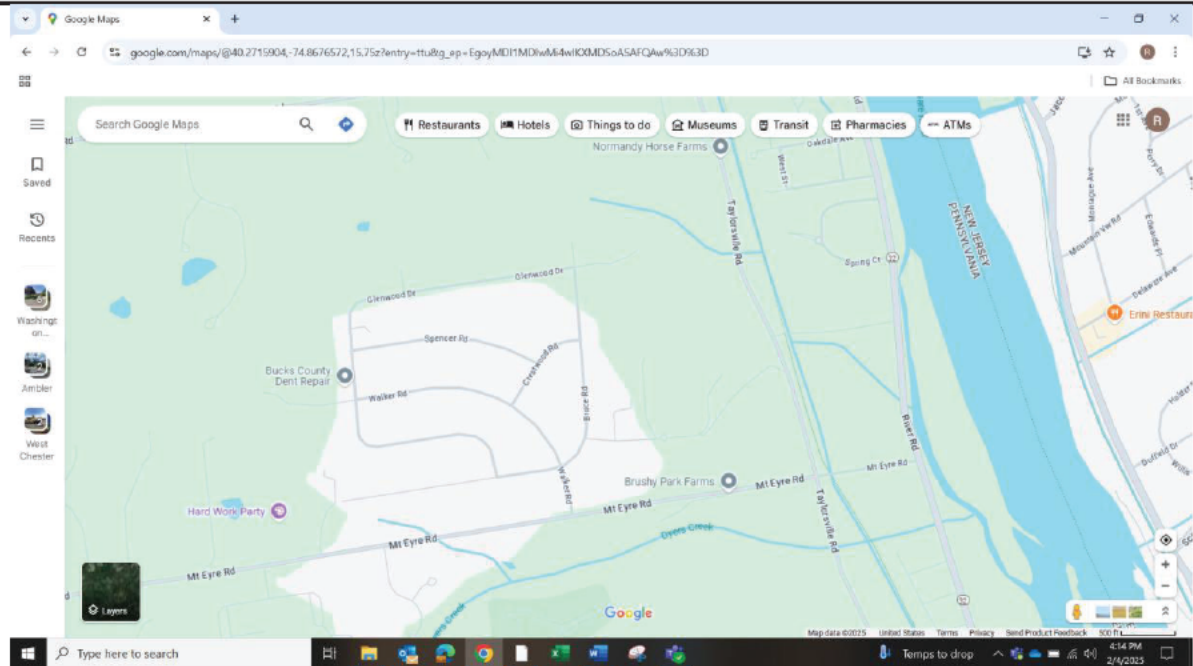

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery Digitally signed by Rebecca Flannery Date: 2025.09.23 13:21:24 -0400	Title Geoscientist	Date: 9-23-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609



Drill rig set up at [REDACTED]
9-17DR-25 @ 10:36am



Close up of drill set up at [REDACTED] – side view
9-17-25 @ 9:39



Hose pumping grout into the well – top view
9-17-25 @ 11:55



Oil dry applied to where hydraulic oil had leaked from the drilling
vehicles
9-17-25 @ 13:27

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery Digitally signed by Rebecca Flannery Date: 2025.09.23 13:02:05 -0400	Title Geoscientist	Date: 9-23-25 Telephone: 484-250-5779
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.			
Interviewee Name	Interviewee Signature	Title	Date: