



NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road
Primary Facility ID: 881609

Inspection Date: 6-2-25		Inspection Time: 8:53am		Lat/Long:	
Program: ECB		☐ Storage Tanks		☐ HSCA	
				☒ LRP	
Owner Name: Energy Transfer			Inspection ID:		Site ID:
Facility Location (911) Address: [REDACTED] Washington Crossing, PA 18977				Municipality: Upper Makefield Twp.	
				County: Bucks	
Responsible Official Name: Brad Fish				Responsible Official Address:	
Title: Senior Environmental Specialist Emergency Response & Remediation				100 Green Street Marcus Hook, PA 19061	
Responsible Official Telephone: 610-859-6297				Interviewee Name:	
Email Address: bradford.fish@energytransfer.com				Affiliation:	
				Email Address:	

Narrative:

I went to visit the site to oversee the morning measuring and gauging event that is performed on the pre-determine residential potable wells and all four recovery wells. Jason Crone and Brian Dunn were present for GES who arrived at 9:20am.

Address	Arrival Time	PID (ppm)	DTP (ft.)	DPW (ft.)	LNAPL thickness (ft.)
[REDACTED]	9:25	304.3	0	38.5	0
	9:36	0.0	0	23.57	0
	9:42	166.9	0	23.66	0
	10:49	21.3	0	43.12	0
	10:55	0.0	0	24.93	0
	11:02	6.4	0	22.71	0
	10:58	0.0	0	38.78	0
Glenwood Drive – RW-2	9:52	18.7	0	19.51	0
Glenwood Drive – RW-3 (pre bail)	9:57	492.1	20.50	20.90	0.4
Glenwood Drive – RW-3 (post bail)	10:32	-	20.60	20.84	0.24
Glenwood Drive – RW-4	10:39	8.4	0	11.90	0

DTP – Depth to product (LNAPL)

DPW – Depth to water

DEP Representative Name Rebecca Flannery		DEP Representative Signature Rebecca Flannery Digitally signed by Rebecca Flannery Date: 2025.06.03 09:20:48 -0400		Title Geoscientist	Date: 6-3-25
					Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>					
Interviewee Name		Interviewee Signature		Title	Date:
					Telephone:

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609_____

Narrative (continued):

Observations from wells that were gauged:

██████████: Resident came out and observed the gauging activities.

RW-3:

- Had 3 small absorbent socks connected in to absorb LNAPL.
- The socks were removed before bailing and were 100% saturated, and placed into in a metal bucket.
- The LNAPL layer was light yellow on the top to a faint brown towards the bottom and sampled at 10:05am.
- LNAPL was bailed and emptied into a separate metal bucket from the absorbent booms.
- LNAPL was bailed to a thickness of 0.24-ft since a second gauging event would be performed. A new set of three dry absorbent booms were replaced in the well.
- There was an estimated 2-gallons of water with approximately 0.5-gallons of LNAPL recovered.
- Additional bailing would be performed during the second gauging event if needed.

██████████: The resident was present observing the gauging activities.

██████████: Grass was being mowed

I drove to the ET trailer and spoke with Nancy Sadlon (ET) to inquire about any future activities occurring at the site. She informed me that the newly installed recovery wells in Glenwood Drive were going to be developed this Wednesday and Thursday. The plan was to pump the development water into a tote and then take it to the pump station near the ET trailer and have it vacuumed out. Nancy also stated that they finished up delivering flyers describing the well development activities, which were already posted on the Township webpage and on SPLP dedicated website.

I departed the site at 11:45am.



DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery Digitally signed by Rebecca Flannery Date: 2025.06.03 08:21:02 -04'00'	Title Geoscientist	Date: 6-3-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609

MAPS / PHOTOGRAPHS / ATTACHMENTS

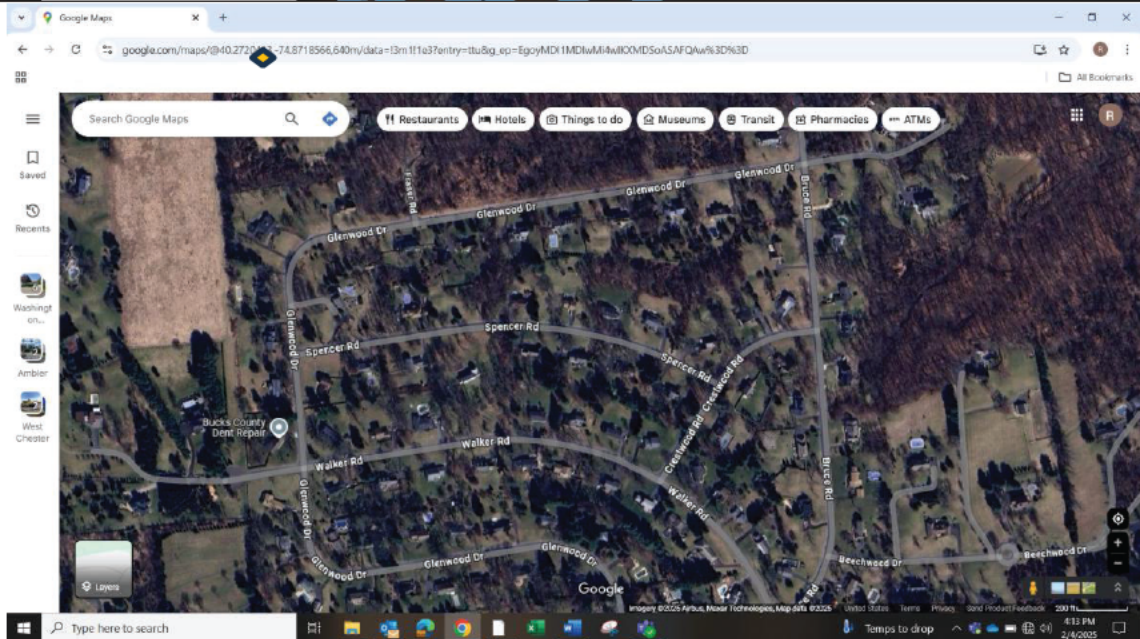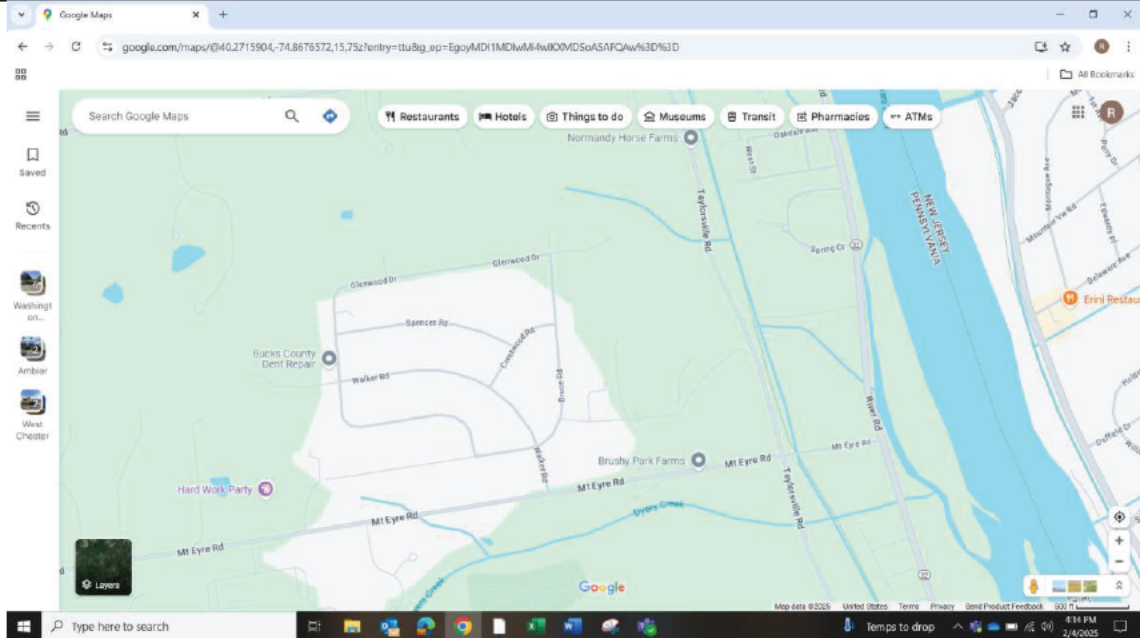

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery Digitally signed by Rebecca Flannery Date: 2025.06.03 08:21:17 -0400	Title Geoscientist	Date: 6-3-25 Telephone: 484-250-5779
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.			
Interviewee Name	Interviewee Signature	Title	Date: Telephone: