

### NARRATIVE REPORT FORM

Facility Name: Glenwood Drive & Walker Road Primary Facility ID: 881609					
Inspection Date: June 6, 2025 Inspection Time:		e: 9:05 to 11:42	Lat/Long: 40	).27076, -74.87578	
Inspecting Program:   Storage	e Tanks	☐ HSCA		⊠ LRP	
Owner Name:	Inspection Nun	nber: Not Applicable	plicable Site ID: 881609		
Facility Location (911) Address: Walker Road, Glenwood Drive, & Spencer Road		Municipality: Upper Makefield Township			
Washington Crossing Road, PA 18977		County: Bucks County			
Responsible Official Name: Bradford Fish		Responsible Official	Responsible Official Address:		
Responsible Official Title: Senior Environmental Specialist		100 Green Street			
Emergency Response & Remediation		Marcus Hook, PA 19061			
Responsible Official Telephone: 610-859-6297		]			
Responsible Email: bradford.fish@energytransfer.com					

#### Narrative:

Purpose of visit: Observe gauging of site related recovery wells and potable wells.

Weather: Sunny 70s to 80s

• Crews onsite: 2 GES crews (one for potable well gauging and the other for pumping recovery wells)

<u>Address</u>	<u>Time</u>	PID (ppm)	DTP (ft.)	DTW (ft.)	LNAPL thickness (ft.)
	9:10	351.6	35.61	36.46	0.85
	11:31	347.3	27.39	27.44	0.05
	10:04	3.5	None	24.86	0
	10:11	65.5	24.29	24.31	0.02
	10:35	1.4	None	41.02	0
	10:41	3.1	None	22.61	0
- recovery well	10:53	8.2	None	22.99	0
- potable well	10:47	6.0	None	38.65	0
– RW-2 (pre-pump)	9:39	12.6	None	21.48	0 – some in bailer
- RW-3 (pre-pump)	9:33	233.0	21.41	21.52	0.11
- RW-3 (post-pump)	Not applicable	Not applicable	30.04	30.05	0.01
<b>–</b> RW-4	9:28	47.1	None	<b>1</b> 3.87	0
DTP - Depth to product (LNAPL) DTW - Depth to water					

DEP Representative Name	DEP Representative Signature	Title	<b>Date:</b> June 6, 2025		
Matthew Sabetta, P.G.	Matthew Sabetta Digitally signed by Matthew Sabetta Date: 2025.06.06 14:19:25 -04'00'	Geologist	Telephone: 484-250-5788		
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report, but does acknowledge that the person was shown the report or that a copy was left with the person.					
Name of Person Interviewed   Signature of Person Interviewed   Title   Date: Not applicable					
Not applicable	Not applicable	Not applicable	Telephone: Not applicable		

### NARRATIVE REPORT FORM

Facility Name:	Glenwood Drive & Walker Road	Primary Facility ID:	881609
shortly: 9:10 – 6 the prof 9:17 – 5 submer 10:07 – continu 11:00 – 11:03 – RW-3 pr the tabl 11:18 – 26.07ft.	to pump the newly installed recovery wells. GES begins gauging the potable wells. 0.85ft duct and collects a sample. Gecond GES crew onsite to pump the recoversible pump.  GES begins pumping RW-3 after gauging and rously lowered as the water level in the well. Potable well gauging complete. GES heads to After talking with the crew pumping the recrior to moving to RW-2. Post pumping measure above.  GES checks RW-2 as it is pumping and measure as the same and measure as the same and measure above.	ry wells. Their plan is to pump RW-d removing the sock. Pump is initial is drawn down. To dump bailed product in drum. Tovery wells, approximately 50 gall urements from RW-3 were given because depth to water of 26.07ft and dapproximately 80 gallons of fluid	well. GES bails 22 and RW-3 using a ally set at 22ft. The pump is ons were removed from by GES and are included in d depth to product of

DEP Representative Name	DEP Representative Signature	Title	<b>Date:</b> June 6, 2025		
Matthew Sabetta, P.G.	Matthew Sabetta Date: 2025.06.06 14:19:45 -04'00'	Geologist	Telephone: 484-250-5788		
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report, but does acknowledge that the person was shown the report or that a copy was left with the person.					
Name of Person Interviewed   Signature of Person Interviewed   Title   Date: Not applicable					
Not applicable	Not applicable	Not applicable	Telephone: Not applicable		



### NARRATIVE REPORT FORM

Facility Name: Glenwood Drive & Walker Road Primary Facility ID: 881609

### MAPS / PHOTOGRAPHS / ATTACHMENTS

Aerial Image of Site Area (source: Google Earth)





DEP Representative Name	DEP Representative Signature	Title	<b>Date:</b> June 6, 2025	
Matthew Sabetta, P.G.	Matthew Sabetta Date: 2025.06.06 14:20:07 -04:00	Geologist	Telephone: 484-250-5788	
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report, but does acknowledge that the person was shown the report or that a copy was left with the person.				
Name of Person Interviewed   Signature of Person Interviewed   Title   Date: Not applicable				
Not applicable	Not applicable	Not applicable	Telephone: Not applicable	

### NARRATIVE REPORT FORM

Facility Name: Glenwood Drive & Walker Road Primary Facility ID: 881609




Gauging setup at



Product in bailer at



Absorbent sock removal from RW-3.

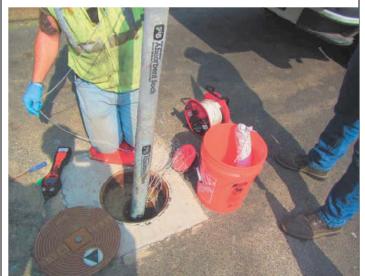

Absorbent sock removal from RW-2.

DEP Representative Name	DEP Representative Signature	Title	Date: June 6, 2025	
Matthew Sabetta, P.G.	Matthew Sabetta Digitally signed by Matthew Sabetta Date: 2025.06.06 14:20:26-04'00'	Geologist	Telephone: 484-250-5788	
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report, but does acknowledge that the person was shown the report or that a copy was left with the person.				
Name of Person Interviewed   Signature of Person Interviewed   Title   Date: Not applicable				
Not applicable	Not applicable	Not applicable	Telephone: Not applicable	



### NARRATIVE REPORT FORM

Facility Name: Glenwood Drive & Walker Road Primary Facility ID: 881609



Submersible pump used to purge RW-2 and RW-3.



Possible separate phase product floating on water in purge tote from RW-2 and RW-3.

DEP Representative Name	DEP Representative Signature	Title	<b>Date:</b> June 6, 2025	
Matthew Sabetta, P.G.	Matthew Sabetta Digitally signed by Matthew Sabetta Date: 2025.06.06 14:20:43 -04'00'	Geologist	Telephone: 484-250-5788	
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report, but does acknowledge that the person was shown the report or that a copy was left with the person.				
Name of Person Interviewed   Signature of Person Interviewed   Title   Date: Not applicable				
Not applicable	Not applicable	Not applicable	Telephone: Not applicable	