



NARRATIVE REPORT FORM

Facility Name: Glenwood Drive & Walker Road

Primary Facility ID: 881609

Inspection Date: 8/1/25		Inspection Time: 9:50 – 11:20		Lat/Long:	
Program:		☐ Storage Tanks		☐ HSCA	
				☒ LRP	
Owner Name:			Inspection ID:		Site ID:
Facility Location (911) Address: Glenwood Drive Washington Crossing, PA 18977				Municipality: Upper Makefield Township	
				County: Bucks	
Responsible Official Name: Bradford Fish Title: Senior Environmental Specialist Emergency Response & Remediation				Responsible Official Address: 100 Green Street Marcus Hook, PA 19061	
Responsible Official Telephone: 610.859.6297 Email Address: Bradford.fish@energytransfer.com				Interviewee Name: Affiliation: Email Address:	

Narrative:

The purpose of today's site visit was to observe installation of monitoring well MW-2S. This well completed the set of one shallow and one deep well located in the township green space that runs parallel to Glenwood Drive. There are six total wells installed in this space. See Photo 3 for reference of completed wells to date.

Entities present at the site included Olivia Budnovitch (DEP), technical staff from Energy Transfer/Sunoco Pipeline, L.P. (SPLP), Groundwater & Environmental Services (GES), Summit Drilling, LLC, and CTEH.

I arrived at the drilling area at 9:50. The drill rig was set up and ready for drilling upon my arrival. The Summit crew informed me that hand digging was completed earlier in the week. Monitoring wells MW-1S, MW-1D, MW-3S, and MW-3D were being developed and flush mounted when I arrived, and these activities continued after my departure.

During drilling CTEH was onsite monitoring noise quality with handheld devices. They also set up Summa canisters (Photo 4) around the drilling area perimeter to collect air samples. Sound barriers shown in photo 5 were set up around drilling to help mitigate noise.

Drilling began at 10:10. Similar to the installation of the other monitoring wells, soil was collected at 5-foot intervals for screening and characterization. No odors were observed, and no fuel was encountered.

The monitoring well was drilled to a total depth of 40 feet below ground surface (bgs). Saprolite was encountered at about 15 feet bgs and competent argillite bedrock was at about 17 feet bgs. Groundwater was encountered at about 34 feet bgs which is also shown in the soil collected for characterization (photo 2). The well was constructed with the same materials as all other monitoring wells.

I departed the site when drilling was finished at 11:20.

DEP Representative Name Olivia Budnovitch	DEP Representative Signature Olivia Budnovitch Digitally signed by Olivia Budnovitch Date: 2025.08.06 09:25:32 -0400	Title Geoscientist	Date: 8/6/25
			Telephone: 484.250.5705
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report, but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date:
			Telephone:


NARRATIVE REPORT FORM

Facility Name: Glenwood Drive & Walker Road


Primary Facility ID: 881609

MAPS / PHOTOGRAPHS / ATTACHMENTS

Map 1: Google Earth screenshot of Washington Crossing Neighborhood

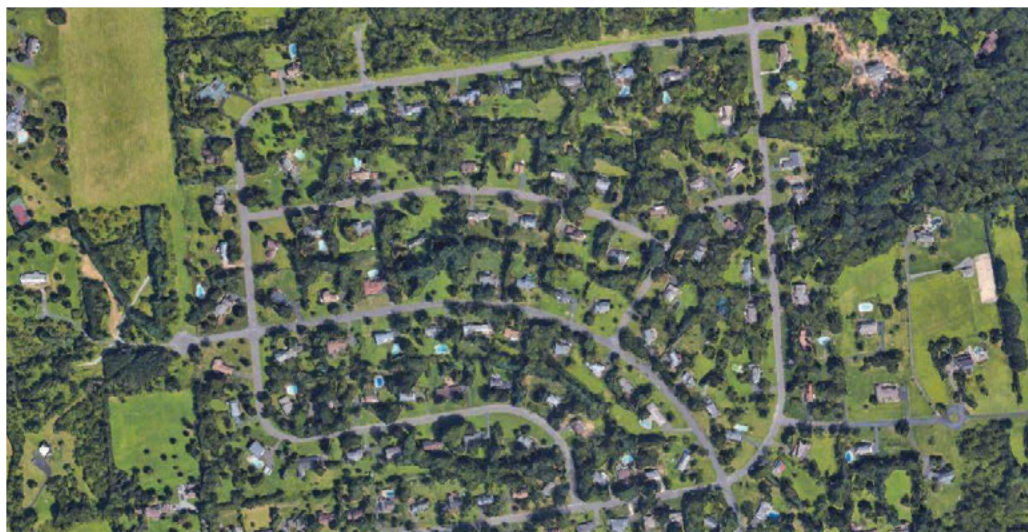

Map 2: Locations of homes with continued gauging or product recovery



DEP Representative Name Olivia Budnovitch	DEP Representative Signature Olivia Budnovitch Digitally signed by Olivia Budnovitch Date: 2025.08.06 09:26:16 -04'00'	Title Geoscientist	Date: 8/6/25 Telephone: 484.250.5705
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report, but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

Facility Name: Glenwood Drive & Walker Road

Primary Facility ID: 881609

Photo 1: Drilling in progress



Photo 2: Staging of soil cuttings from 5-foot intervals



Photo 3: Map of proposed and completed wells to date

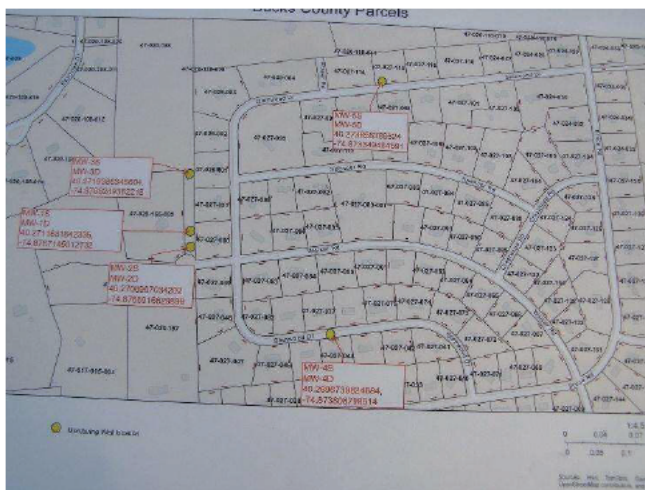


Photo 4: Summa canister for air monitoring



DEP Representative Name Olivia Budnovitch	DEP Representative Signature Digitally signed by Olivia Budnovitch Date: 2025.08.06 09:26:58 -0400	Title Geoscientist	Date: 8/6/25 Telephone: 484.250.5705
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report, but does acknowledge that the person was shown the report or that a copy was left with the person.			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

Facility Name: Glenwood Drive & Walker Road

Primary Facility ID: 881609

Photo 5: Sound barrier staging



Photo 6: Well Development of MW-15



Photo 7: Well development water



DEP Representative Name Olivia Budnovitch	DEP Representative Signature Olivia Budnovitch Digitally signed by Olivia Budnovitch Date: 2025.08.06 09:27:37 -0400	Title Geoscientist	Date: 8/6/25 Telephone:
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report, but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone: