



NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609 _____

Inspection Date: 9-8-25		Inspection Time: 8:55		Lat/Long:																
Program: ECB		☐ Storage Tanks		☐ HSCA																
				☒ LRP																
Owner Name: Energy Transfer			Inspection ID:		Site ID:															
Facility Location (911) Address: Glenwood Drive and Walker Road Washington Crossing, PA 18977				Municipality: Upper Makefield Twp.																
				County: Bucks																
Responsible Official Name: Brad Fish				Responsible Official Address:																
Title: Senior Environmental Specialist Emergency Response & Remediation				100 Green Street Marcus Hook, PA 19061																
Responsible Official Telephone: 610-859-6297																				
Email Address: bradford.fish@energytransfer.com																				
Entities Present:																				
DEP – Rebecca Flannery																				
GES – Mike Haezebrouck and Ariana Miranda(drilling) – Lucas Pfouts and Tom Veasy (gauging)																				
ET – Chris Embry, Eljia Contreas, Bill Barth, Ryan Dipper, and Nany Sadlon																				
Stantec - Air and Sound Monitoring																				
Purpose: Oversight of monitoring well MW-11D installation at [REDACTED]																				
Weather: Sunny; 60's																				
Narrative:																				
I arrived at 8:55am at [REDACTED] to observe the installation of monitoring well MW-11D.																				
The locations for monitoring wells MW-11S and MW-11D were precleared prior to installing the wells.																				
<table border="1" style="width: 100%; border-collapse: collapse; text-align: center;"> <thead> <tr> <th>Well Location</th> <th>Depth (bgs)</th> <th>PID reading (ppm)</th> <th>Highest PID (ppm)</th> <th>Depth (bgs.)</th> </tr> </thead> <tbody> <tr> <td>MW-11S</td> <td>3.5' refusal</td> <td>18.3</td> <td>17.8</td> <td>2'</td> </tr> <tr> <td>MW-11D</td> <td>3.25' refusal</td> <td>12.5</td> <td>-</td> <td>-</td> </tr> </tbody> </table>						Well Location	Depth (bgs)	PID reading (ppm)	Highest PID (ppm)	Depth (bgs.)	MW-11S	3.5' refusal	18.3	17.8	2'	MW-11D	3.25' refusal	12.5	-	-
Well Location	Depth (bgs)	PID reading (ppm)	Highest PID (ppm)	Depth (bgs.)																
MW-11S	3.5' refusal	18.3	17.8	2'																
MW-11D	3.25' refusal	12.5	-	-																
Observations:																				
- The following addresses had the potable wells gauged pre and post drilling: [REDACTED], and [REDACTED]. [REDACTED] and [REDACTED]. - A new bolt and well cap was installed at [REDACTED] at 13:55. - The drilling of monitoring well MW-11D began at 14:10. It was paused at 14:28 at 30-feet bgs to allow water to enter the well hole if available. Drilling restarted at 14:50 and stopped at 15:42 when the target depth of 75-feet was achieved. - A slight petroleum odor was detected at 13-feet bgs with a PID reading of 10.3ppm. and between 30-31-feet bgs with a PID reading of 1.0. - Drill cuttings were logged and screened approximately every 5 feet. - All drill cuttings and water from the installation of the well was placed into 55-gallon drums to be disposed of later. Water was also pumped out and into a vacuum truck. - Competent bedrock was encountered at 25-feet bgs. and groundwater was encountered at a depth of 30-feet bgs.																				

DEP Representative Name Rebecca Flannery		DEP Representative Signature Rebecca Flannery Digitally signed by Rebecca Flannery Date: 2025.09.16 11:04:44 -0400		Title Geoscientist		Date: 9-16-25	
						Telephone: 484-250-5779	
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.							
Interviewee Name		Interviewee Signature		Title		Date:	
						Telephone:	



NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609 _____

Narrative (continued):

Residential Interactions:

- Chris E and I went to speak with the resident at [REDACTED] to inform [REDACTED] that [REDACTED] potable well was going to be dropped to being gauged once a week from daily. I let [REDACTED] know that if anything came back it would go back to daily gauging. [REDACTED] said that was fine.
- While the installation of monitoring well MW-11D was being installed, I spoke to the resident from [REDACTED] along with Chris E. [REDACTED] stated that [REDACTED] water pressure was low in [REDACTED] house. [REDACTED] has Suburban Water out to look at [REDACTED] system. [REDACTED] told me that the pressure got better after the sediment filter was replaced. [REDACTED] told me that according to the Suburban Water employee it would have to be changed every 7-10 days or when there was lower pressure and that the pressure should improve. I asked [REDACTED] to let us know if changing the filter in the future did not solve the pressure issue.



I departed the site at 16:05

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery Digitally signed by Rebecca Flannery Date: 2025.09.16 11:04:57 -04'00'	Title Geoscientist	Date: 9-16-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road
Primary Facility ID: 881609

MAPS / PHOTOGRAPHS / ATTACHMENTS

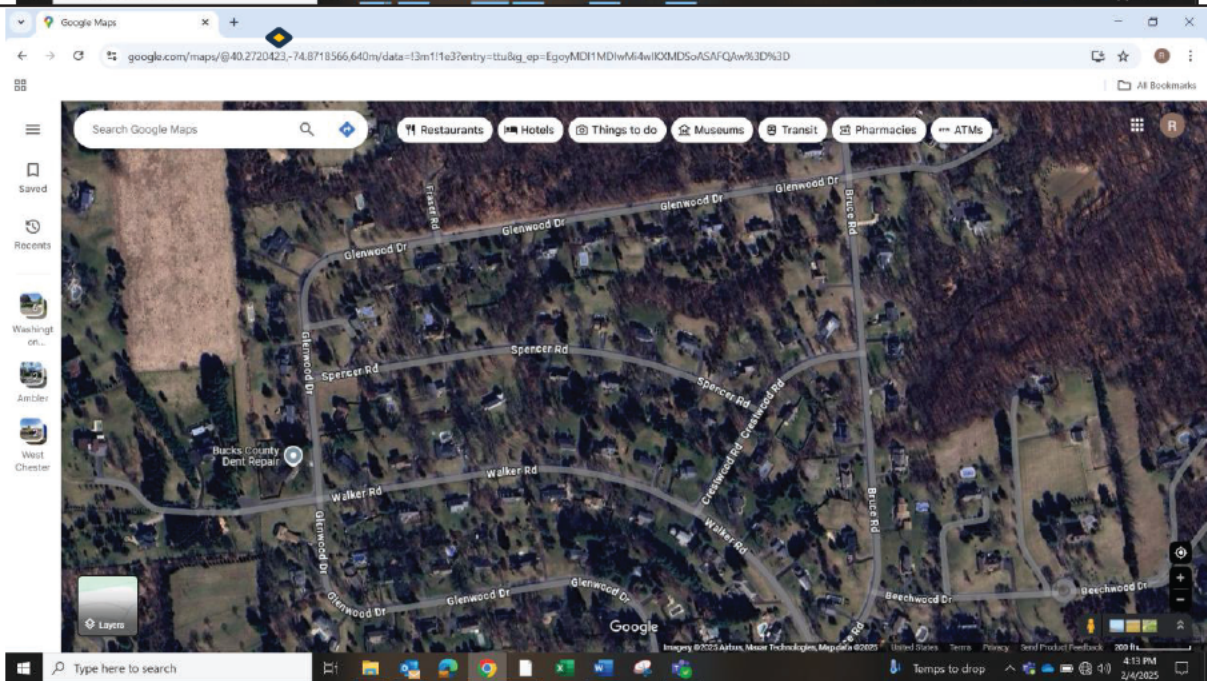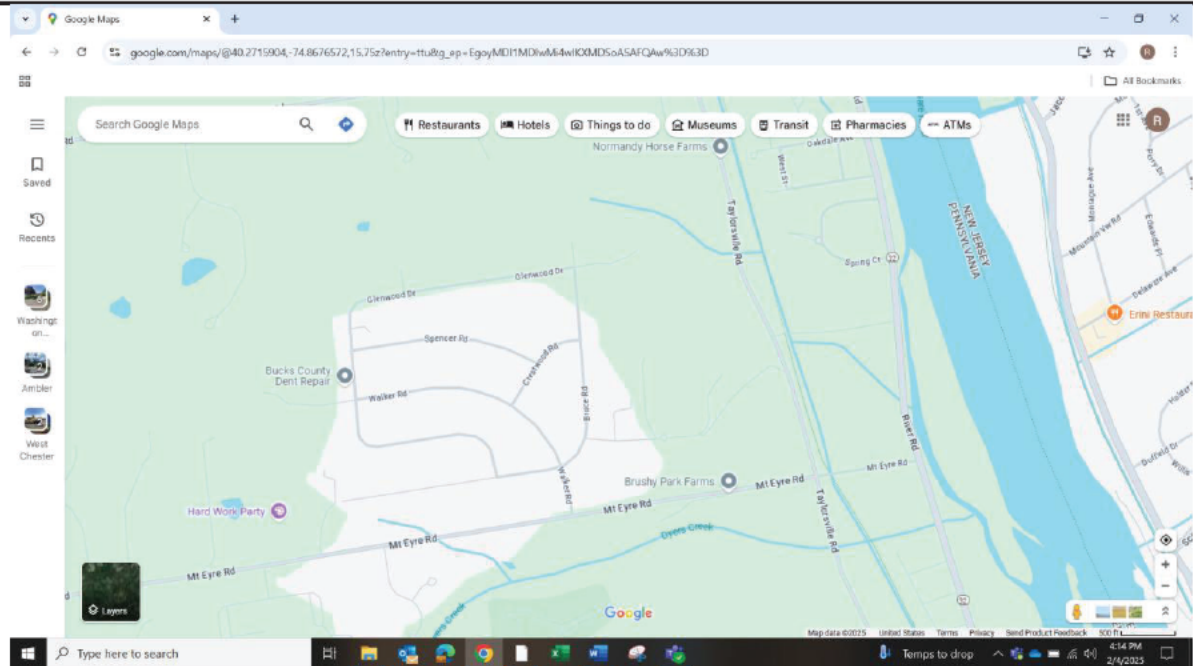

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery Digitally signed by Rebecca Flannery Date: 2025.09.16 11:05:10 -04'00'	Title Geoscientist	Date: 9-16-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

NARRATIVE REPORT FORM

 Facility Name: Glenwood Drive and Walker Road

 Primary Facility ID: 881609

 Sound barriers set up at [REDACTED]
 9-8-25

 Sound barriers set up at [REDACTED]
 9-8-25

 Drill rig set up at [REDACTED]
 9-8-25

 Sound barriers between house and drill rig
 9-8-25

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery Digitally signed by Rebecca Flannery Date: 2025.09.16 11:05:23 -0400	Title Geoscientist	Date: 9-16-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date:

NARRATIVE REPORT FORM

 Facility Name: Glenwood Drive and Walker Road

 Primary Facility ID: 881609


Coal shale (dark liquid) floating on water from MW-11D
9-8-25

75 feet ← ----- 45 feet



5 feet ----- → 40 feet

Soil samples from every 5 feet while installing MW-11D
9-8-25



Labeled waste drums from MW-11D
9-8-25

Intentionally Left Blank

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery Digitally signed by Rebecca Flannery Date: 2025.09.16 11:05:41 -0400	Title Geoscientist	Date: 9-16-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: