



NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road:
Primary Facility ID: 881609 _____

Inspection Date: 9-18-25		Inspection Time: 8:57		Lat/Long:	
Program: ECB		☐ Storage Tanks		☐ HSCA	
				☒ LRP	
Owner Name: Energy Transfer			Inspection ID:		Site ID:
Facility Location (911) Address: Glenwood Drive and Walker Road Washington Crossing, PA 18977				Municipality: Upper Makefield Twp.	
				County: Bucks	
Responsible Official Name: Brad Fish				Responsible Official Address:	
Title: Senior Environmental Specialist Emergency Response & Remediation				100 Green Street Marcus Hook, PA 19061	
Responsible Official Telephone: 610-859-6297					
Email Address: bradford.fish@energytransfer.com					
Entities Present:					
DEP – Rebecca Flannery					
ET – Chris Embry, Elija Contreas, Nancy Sadlon, and Joe Masarro					
RETTEW – David Anderson					
Stantec - Air and Sound Monitoring					
Raab Drilling – Potable well installation					
Anson – Traffic control					
Earth Data Northeast – Dave Fennimore					
Purpose: Oversight of potable well installation at [REDACTED]					
Weather: Mostly sunny					
Narrative:					
- I arrived at 8:57am and was briefed by Chris E of ET the planned activities for the day which included drilling through the grout, change to a 6" drill bit and drill to 150 feet bgs. Geophysics was a possibility if the well drilling was completed. - The drilling though the grout began at 9:36am. - All the water and drill debris was either put into a vacuum truck or placed in the roll off dumpster that was on a truck. - After the grout was drilled through to 81 feet bgs, temporary casing was installed for the 6' drill bit could drill to the target depth of 150 feet bgs began at 11:10am. - Drilling was paused for a little while as there were dust issues. - The rock cuttings were collected every 5 feet for screening and logging purposes. - There were no PID detections while this portion of the well was being drilled. - Drilling stopped when the target depth of 150 feet bgs was reached at 12:08pm - The plan for the rest of the day was to remove the drilling rods and perform geophysics on the hole to determine where it should be cased. - I did speak with the GES gauging crew when the potable well at [REDACTED] was being gauged. There was 0.12' of LNAPL measured in the well. A LNAPL sample was collected and then the well was bailed until a depth of 0.01' was reached. - I did notice that there were some hydraulic oil spots that seemed to be coming from the drilling vehicles where they were parked along Walker Road. There was also a small sheen on some discharged water that came from the truck. ET laid down absorbent pads, small booms, and oil dry. There were also some absorbent pads placed under a few of the vehicles which showed hydraulic oil stains under them. - The discharged water only traveled about 30 feet past the driveway to [REDACTED]. - I departed the site at 12:35					



DEP Representative Name Rebecca Flannery		DEP Representative Signature Rebecca Flannery <i>Digitally signed by Rebecca Flannery Date: 2025.06.24 17:00:04 -0400</i>		Title Geoscientist	Date: 9-24-25
					Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>					
Interviewee Name		Interviewee Signature		Title	Date:
					Telephone:

NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609

MAPS / PHOTOGRAPHS / ATTACHMENTS

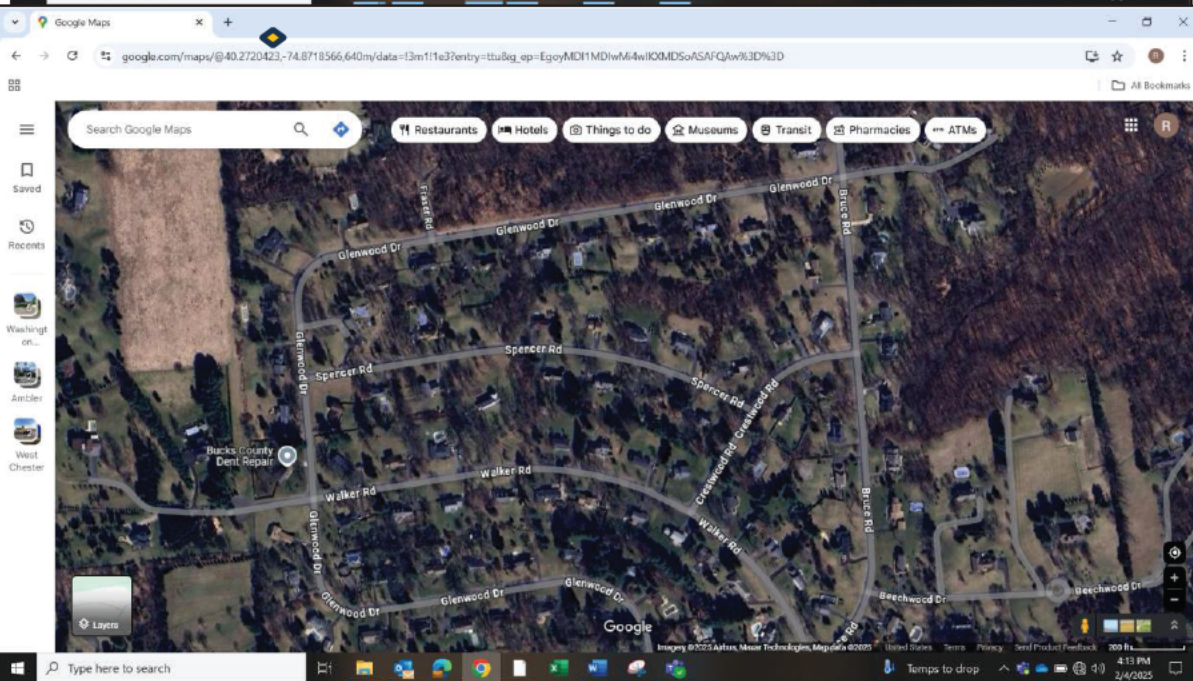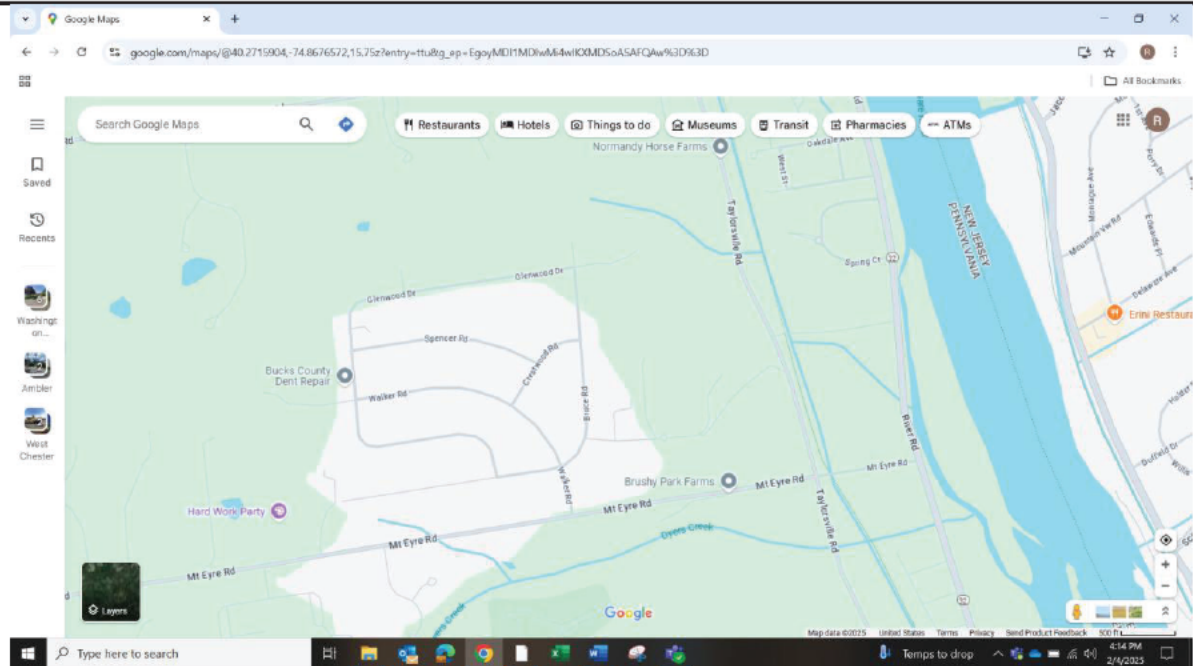

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery Digitally signed by Rebecca Flannery Date: 2025.09.24 17:40:18 -0400	Title Geoscientist	Date: 9-24-25 Telephone: 484-250-5779
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

NARRATIVE REPORT FORM

 Facility Name: Glenwood Drive and Walker Road

 Primary Facility ID: 881609


Drill rig set up over grouted well
9-18--25 @ 9:33am



Grout from well while drilling to 81 feet bgs.
9-18-25 @ 9:47



Absorbent pads under drill vehicle and sheen on water along curb in
front of [redacted]

9-18-25 @10:29



Drill rig setup over well hole after reaching 150 feet bgs.
9-18-25 @ 10:58

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery Digitally signed by Rebecca Flannery Date: 2025.09.24 17:40:26 -0400	Title Geoscientist	Date: 9-24-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: