



NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road:

Primary Facility ID: 881609 _____

Inspection Date: 11-5-25		Inspection Time: 9:18		Lat/Long:	
Program: ECB		<input type="checkbox"/> Storage Tanks		<input type="checkbox"/> HSCA	
				<input checked="" type="checkbox"/> LRP	
Owner Name: Energy Transfer			Inspection ID:		Site ID:
Facility Location (911) Address: Glenwood Drive and Walker Road Washington Crossing, PA 18977				Municipality: Upper Makefield Twp.	
				County: Bucks	
Responsible Official Name: Brad Fish				Responsible Official Address:	
Title: Senior Environmental Specialist Emergency Response & Remediation				100 Green Street Marcus Hook, PA 19061	
Responsible Official Telephone: 610-859-6297					
Email Address: bradford.fish@energytransfer.com					
Entities Present: DEP – Rebecca Flannery ET –Shannon Clemens, Connor Morris, Nancy Sadlon and Matt Gordon PHSMA OTIS Minnesota – Excavation Company					
Purpose: Observe the replacement of the pipeline along Taylorsville Road					
Weather: Cloudy and mid-50's					
Narrative: <u>Observations:</u>					
<ul style="list-style-type: none"> - When I arrived at the excavation area, I noticed that the shoring was installed to about a depth of 15 feet bgs. I observed water flowing from Taylorsville Road toward the canal in the east. - There were four water pumps that were in the excavation which pumped the water out to flow through two filter bags, a layer of hay and then through the soil before eventually reaching the canal. - I arrived on the site; I asked Matt G what the goals of the day were. He informed me that the goal was to cut out 20-feet of piping out and then replace it. - A cold cutter was used to cut the pipe. A small section was cut out first so that a hose connected to a vacuum truck could be inserted to make sure no liquid was remaining in the pipe. - A baby pool was placed under each section that was being cut to capture any potential liquid that might be released after the pipe was cut. - After the pipe was vacuumed out, the other end of the pipe was cut. - I did not notice any liquid in the baby pool after the pipe was cut. - Before the pipe was removed from the excavation, plugs were placed in each end of the pipe as a precaution. - After the pipe was out of the excavation, it was completely wrapped in plastic then set on blocks of wood until it was removed from the site to be analyzed in Texas. - I did not notice any petroleum odors while on site. - I did not observe any evidence of a release from the pipe after it was removed. - I departed the site at 12:10. 					



DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Digitally signed by Rebecca Flannery Date: 2025.11.17 10:53:36 -05'00'</small>	Title Geoscientist	Date: 11-17-25
			Telephone: 484-250-5779
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.			
Interviewee Name	Interviewee Signature	Title	Date:
			Telephone:

NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609

MAPS / PHOTOGRAPHS / ATTACHMENTS

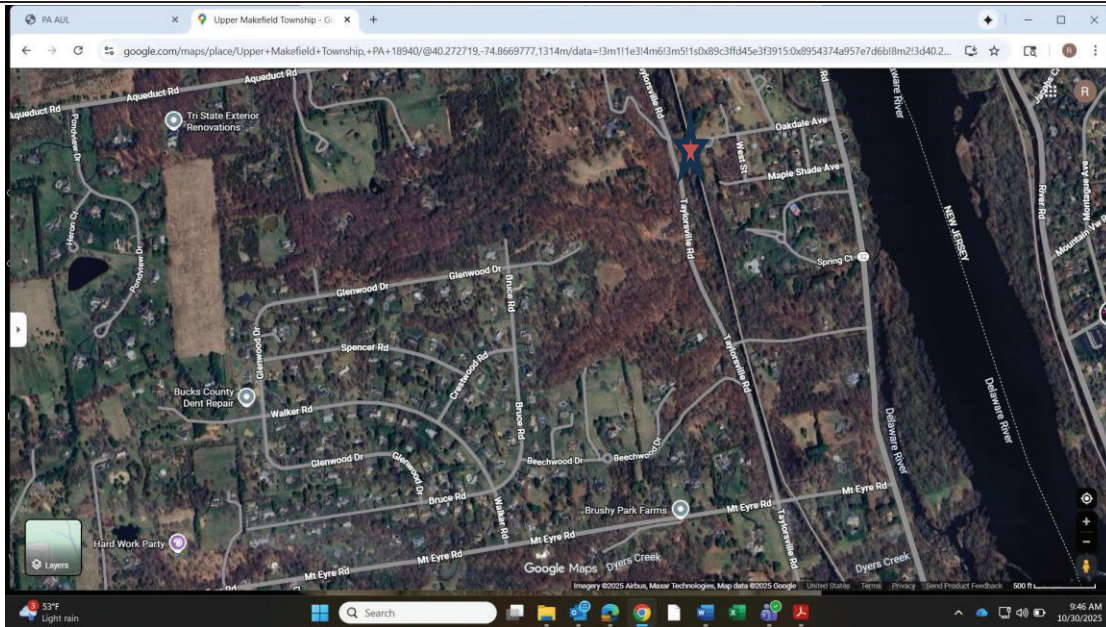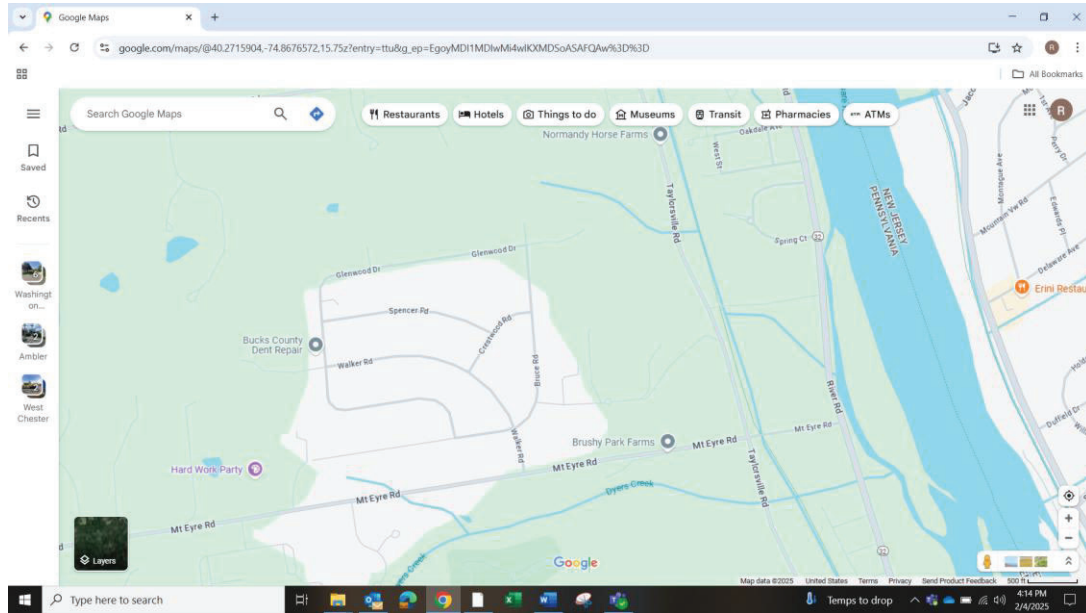

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Digitally signed by Rebecca Flannery Date: 2025.11.17 10:53:50 -05'00'</small>	Title Geoscientist	Date: 11-17-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609



Looking East at pipe replacement area
11-5-25



Kiddie pool placed under pipe to catch any remaining fluid in the pipe
when cut
11-5-25



Cold cut clam device to cut pipe
11-5-25



Small section of pipeline cut
11-5-25

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Digitally signed by Rebecca Flannery Date: 2025.11.17 10:54:04 -05'00'</small>	Title Geoscientist	Date: 11-17-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date:

NARRATIVE REPORT FORM

 Facility Name: Glenwood Drive and Walker Road

 Primary Facility ID: 881609


Closeup of section of pipe cut out
11-5-25



20-foot section of pipeline that was removed
11-5-25



Removed pipeline wrapped in plastic to be sent to TX
11-5-25



Excavation with section of pipe gone
11-5-25

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Digitally signed by Rebecca Flannery Date: 2025.11.17 10:54:24 -05'00'</small>	Title Geoscientist	Date: 11-17-25 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: