

NARRATIVE REPORT FORM
Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609 _____

Inspection Date: 1-5-26	Inspection Time: 8:55	Lat/Long:		
Program: ECB	<input type="checkbox"/> Storage Tanks	<input type="checkbox"/> HSCA	<input checked="" type="checkbox"/> LRP	
Owner Name: Energy Transfer		Inspection ID:	Site ID:	
Facility Location (911) Address: Glenwood Drive and Walker Road Washington Crossing, PA 18977		Municipality: Upper Makefield Twp.		
		County: Bucks		
Responsible Official Name: Brad Fish		Responsible Official Address: 100 Green Street Marcus Hook, PA 19061		
Title: Senior Environmental Specialist Emergency Response & Remediation				
Responsible Official Telephone: 610-859-6297 Email Address: bradford.fish@energytransfer.com				
Entities Present: DEP – Rebecca Flannery GES – Devin Graham, Andy Wallet ET – Nancy Sadlon				
Purpose: Oversight of Weekly gauging of potable wells and recovery wells on Glenwood Drive				
Weather: Cloudy, high 20's				
Narrative: <u>Observed Gauging data:</u>				
Address	Time	PID (ppm)	DTP (ft.)	DPW (ft.)
(pre bail)	09:11	48.4	-	30.61
	9:24	0.0	-	29.21
(pre sock)	9:32	100.4	29.92	30.10
(post sock)	9:41		-	29.83
	10:00	3.0	-	39.58
	9:58	0.7	-	57.04
RW-2 (Glenwood Drive) w/skimmer	10:11	238.8		26.83
RW-2 (Glenwood Drive) w/o skimmer	10.16	-	-	26.40
RW-3(Glenwood Drive) w/skimmer	10:23	261.9	-	24.89
RW-3 (Glenwood Drive) w/o skimmer	10:27	-	-	25.79
DTP – Depth to product (LNAPL) DPW – Depth to water				

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Digitally signed by Rebecca Flannery Date: 2025-01-05 14:39:56-05:00</small>	Title Geoscientist	Date: 1-5-26
Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.			
Interviewee Name	Interviewee Signature	Title	Date:
			Telephone:

NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609 _____

Narrative (continued):

Information from GES:

- Gauging only occurs on Monday, Wednesday, and Fridays.
- There was an absorbent sock installed last Friday at [REDACTED] and [REDACTED].
- A replacement absorbent sock will be installed at [REDACTED] after second gauging event.

Observations:

- Suburban Water was present in the neighborhood performing routine maintenance.

[REDACTED]:

- The well was gauged with absorbent sock in
- After the sock was pulled, GES estimated it to be 100% saturated.
- A total of five (5) full bales were removed from the well and placed into the graduated cylinder.
- I observed a small sheen of LNAPL and decayed matter.
- The well was not gauged again after the water was bailed out
- The resident observed the activities.

[REDACTED]:

- The well was gauged with absorbent sock in
- After the sock was pulled, GES estimated it to be 100% saturated.
- A total of five (5) full bales were removed from the well and placed into the graduated cylinder.
- The amount of LNAPL was estimated to be around 450mL.
- A LNAPL sample was collected at 9:38.
- A new absorbent sock was installed in the well.

[REDACTED]:

- The resident observed the gauging of their potable well.

Recovery well RW-2:

- Depth to LNAPL/water was gauged with skimmer in
- Before the LNAPL was emptied into the graduated cylinder, a sample was collected at 10:15.
- The skimmer only contained LNAPL, no water.
- There was 130mL of LNAPL measured in the graduated cylinder.
- All water and LNAPL was placed in a metal bucket to be disposed of later.
- The depth to water was gauged again and then the skimmer was replaced into the recovery well.

Recovery Well RW-3:

- Depth to LNAPL/water was gauged with skimmer in
- Before the LNAPL was emptied into the graduated cylinder, a sample was collected at 10:25.
- The skimmer only contained LNAPL, no water.
- There was 890mL of LNAPL measured in the graduated cylinder.
- All water and LNAPL was placed in a metal bucket to be disposed of later.
- The depth to water was gauged again and then the skimmer was replaced into the recovery well.

I departed the site at 10:32.



DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Digital signature by Rebecca Flannery Date: 2026.01.05 14:40:10 -05'00"</small>	Title Geoscientist	Date: 1-5-26 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker Road

Primary Facility ID: 881609

MAPS / PHOTOGRAPHS / ATTACHMENTS

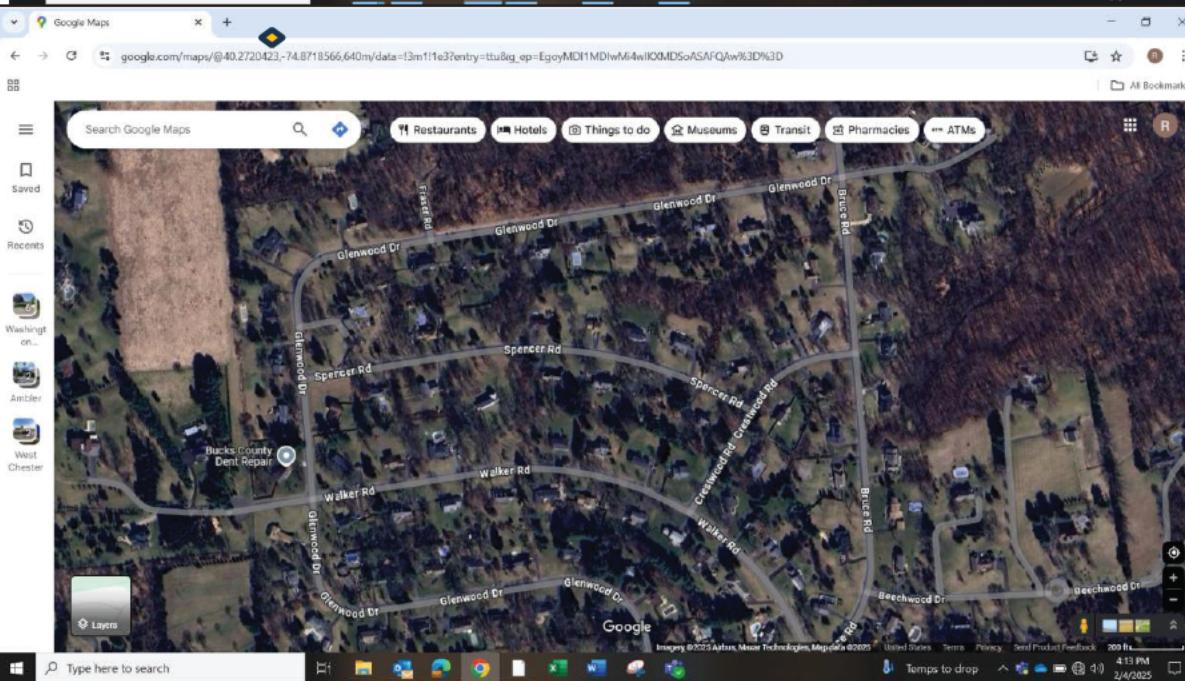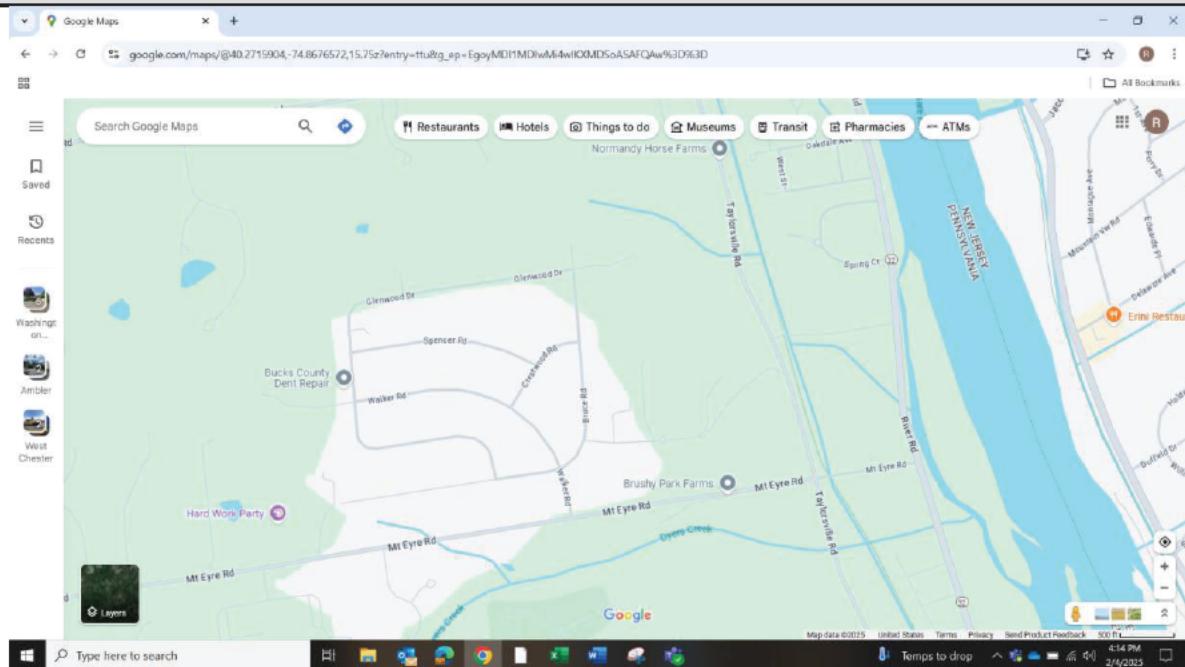

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Digital signature by Rebecca Flannery Date: 2026.01.05 14:40:29 -0500</small>	Title Geoscientist	Date: 1-5-26 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: Telephone:

NARRATIVE REPORT FORM
Facility Name: Glenwood Drive and Walker RoadPrimary Facility ID: 881609
 Recovered absorbent sock from well at
 1-5-26 @ 9:12

 Bailed water from potable well at
 1-5-26 @ 9:16

 Recovered absorbent sock from well at
 1-5-26 @ 9:36

 Amount of LNAPL recovered from
 1-5-26 @ 9:41 (150mL)

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Digitally signed by Rebecca Flannery Date: 2026.01.05 14:40:42 -05'00'</small>	Title Geoscientist	Date: 1-5-26 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date:

NARRATIVE REPORT FORM

Facility Name: Glenwood Drive and Walker RoadPrimary Facility ID: 881609

Skimmer removed from recovery well RW-3 on Glenwood Drive
 1-5-26 @ 10:12



Amount of LNAPL recovered from RW-3 (130 mL)
 1-5-26 @ 10:14



Skimmer removed from recovery well RW-3 on Glenwood Drive
 1-5-26 @ 10:22

Intentionally Left Blank

DEP Representative Name Rebecca Flannery	DEP Representative Signature Rebecca Flannery <small>Digitally signed by Rebecca Flannery Date: 2026.01.05 14:40:55 -05'00'</small>	Title Geoscientist	Date: 1-5-26 Telephone: 484-250-5779
<i>Signature by the person interviewed does not necessarily imply concurrence with the findings on this report but does acknowledge that the person was shown the report or that a copy was left with the person.</i>			
Interviewee Name	Interviewee Signature	Title	Date: